# U.S. PUBLIC LAND SURVEY MONUMENT RECORD

NOTE: This form is intended and designed to fulfill all requirements of Wisconsin Administrative Code, Chapter A-E 7.08 U.S. Public Land Survey Monument Record. An additional sheet may be added if necessary to conform with said requirements.

#### CORNER LOCATION

Section Corner common to Sections 2, 3, 10 and 11 Township 35 North, Range 5 East of the 4th P.M. Town of Somo, Lincoln County, Wisconsin

#### HISTORY OF ORIGINAL CORNER ESTABLISHMENT

ORIGINAL SURVEYOR:

Edward D. Palmer

DATE OF SURVEY: ORIGINAL ACCESSORIES: Commenced April 1865 Finished May 1865 "Set post for corner to sections 2, 3, 10 & 11"

Birch 9 N25°W 18 links Birch 11 N75°E 24 links Hemlock 7 S40°E 22 links Hemlock 12 S47°W 17 links

6	5	4	3	2	1
7	8	9	10	11	12
18	17	16	15	14	13
19	20	21	22	23	24
30	29	28	27	26	25
31	32	33	34	35	36

T35N - R4E

DESCRIPTION OF MONUMENT FOUND AT THIS CORNER AND IF IT WAS ACCEPTED, STATE ALL EVIDENCE (MATERIAL, TESTIMONIAL, OCCUPATIONAL, PLATS, RECORDS, OTHER MONUMENTS) USED AS A BASIS FOR ACCEPTING. IF NOT ACCEPTED OR IF NOTHING WAS FOUND, STATE EVIDENCE USED AS BASIS FOR ESTABLISHING LOCATION. IF RE-ESTABLISHED THROUGH LOST CORNER PROPORTIONATE METHODS, INDICATE ALL MONUMENTS, DISTANCES AND DIRECTIONS USED TO ESTABLISH. INDICATE TYPE OF MONUMENT AND SIGN POST FOUND OR SET.

Sep. 1923 - D.S. Burnett ran the north line of Section 10. "From Section corner common to Sections 3, 4, 9 and 10

under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my

12-26-14

knowledge and belief.

Chad A. Besaw, RLS No. S-3029 STEIGERWALDT LAND SURVEYING, LLC

Rev

36.43 chains W. edge Somo River, 37.38 chains E. edge Somo River, 38.46 chains had Var. S of Smith's 1/4 corner 79 lks, 38.70 chains had Var. S of Thomas' 1/4 corner 80 lks, 41.21 chains CL traveled track of highway, 77.29 chains Var S. 1.55 chains identified cor of 2-3-10-11 by a 2"x2" steel bar and B.T. S.M. 16" N59°W 46 ½ links. Set monument no other trees to mark". Although it is not stated in the field notes D.S. Burnett had the reputation of setting a 2.5" iron pipe with 5"x5" steel plates on top and bottom and a steel rod through the middle bent over at each end at corner locations (commonly referred to as a Burnett monument).

Nov. 1974 - Robert Winat re-established the corner location using the road and fence to the south. Resident witnesses to corner: William Sanderson, Clarence Marheine. "No evidence of D.S. Burnett's 1923 re-survey monument was found, although Mr. William Sanderson, a longtime resident of the area, states the plate was visible in the road at the fence line for many years. However, the distance along the south line of Section 3 is only 1.8 feet shorter than D.S. Burnett's in 1923, the original road to the west and the existing road intersect at this point and the existing road and a tree line west of the Big Somo River match the Section line location." Witnessed by: PK with disc in 3" maple \$70°E 52.20', PK with disc in 4" fence post \$35°W 31.58', PK with disc in 8" aspen N14°E 37.50', PK with disc in 5" maple N75°E 85.04'.


Dec. 2014 - Chad A. Besaw found Winat's Berntsen monument 4' north of CL Carpenter Rd. broken off and down 12" from road surface. I accepted the midpoint of the remaining section of the Berntsen monument as the corner location and will replace the broken monument with a new berntsen after the road thaws. See Section Summary filed with this USPLS monument record. Witnessed as shown below:

PLAN VIEW OF CORNER WITH TIES TO AT LEAST 4 WITNESS MONUMENTS. IF IN DISAGREEMENT WITH PREVIOUSLY ESTABLISHED CORNER, SHOW THE DISTANCES BETWEEN THE TWO CORNERS AND ALSO INDICATE THE TIES TO THE DISPUTED. 7/8" capped rebar 1' SW of 7/8" capped rebar 3.9' SE of 4" balsam Bearings Lincoln County Grid Found broken berntsen hwy monument (to be replaced in spring) CL Carpenter Rd. Fence Line 7/8" capped rebar 0.5" 3 East of wood fence post Drive RECEIVED BY LINCOLN COLWhite vinyl T-post set 0.5' South 7/8" capped rebar 1' NW of 5" double blazed aspen SURVEYOR THIS 26 ence SCALE: 1" = 30" SCONSIA Line I, Chad A. Besaw, Registered Land Surveyor No. S-3029, hereby certify that the corner location on this record was determined by me or MEKO. WI WI OR

## Resident witnesses:

William Sanderson

Clarence Marheine

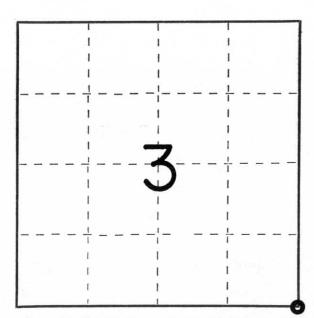

O = Corner monument restored.

### CERTIFIED LAND CORNER RESTORATION

Index No. *E* - 17

History of original corner establishment:

Surveyor: Edward D. Palmer

Date: April and May, 1865

Monumentation: Wood Post

Witnesses: 9" Birch N25°W 18 lks. 11" Birch N75°E 24 lks.

7" Hemlock S40°E 22 lks. 12" Hemlock S47°W 17 lks.

Description of corner evidence found:

The corner common to Sections 2, 3, 10 and 11 was re-established, using the road and fence to the south. No evidence of D.S. Burnett's 1923 re-survey monument was found, although Mr. William Sanderson, a long time resident of the area, states the plate was visible in the road at the fence line for many years. However, the distance along the south line of Section 3 is only 1.8 feet shorter than D.S. Burnett's in 1923, the original road to the west and the existing road intersect at this point and the existing road and a tree line west of the Big Somo River match the section line location.

Description of monument and accessories I established to perpetuate the original location of this corner.

Lincoln Co. Berntsen monument 36"
4' N. of centerline
PK/Disc in 3" Maple S70°E 52.20'
PK/Disc in 4" Fence post S35°W, 31.58'
PK/Disc in 8" Aspen N14°E, 37.50'
PK/Disc in 5" Maple N75°E, 85.04'

Dated at Minocqua	Wis., this	15th	day of	November	
Signature Osterf H. Minat (County Surveyor, Registere					
Office of Register of Deeds, County of  Instrument was filed in this office for reco					
(Register of Deeds)					