

Saindon Road
(3 rod road as per town chairman)

NW corner, Section 24
Found a broken Bernissen aluminum monument in the road.

W 1/4 corner, Section 24
The County Surveyor recently determined that this was a lost corner. By single proportionate measurement, I set a 1" x 24" stainless steel pipe with brass washer, top of which is 6" below the road surface.

Coffee Creek Road

S 88°09'48" E 2668.66'

N 1/4 corner, Section 24
Found 1" iron pipe in road recently set by County Surveyor.

E 1/4 corner, Section 24
Found aluminum capped rebar recently set by County Surveyor.

Swamp Road
S 0°09'01" W 2639.77'

NW - SW
40.7 acres

NE - SW
40.6 acres

SW corner, Section 24
Found 6" dia. concrete monument recently set by County Surveyor.

N 88°50'35" W 2671.50'

S 1/4 corner, Section 24
The County Surveyor recently determined that this corner was a lost corner. By single proportionate measurement, I set a 1" x 60" aluminum capped aluminum rod monument for the corner.

N 88°50'35" W 2671.50'

SE corner, Section 24
Found aluminum Bernissen monument in road.


LEGEND

- iron rod set
- These iron rods are between 3/4" and 1" dia. and range from 24" to 32" long, have barbed points welded on near the bottom and are topped with a stainless steel plate ranging in size from about 2.5" square to about 6" square.
- 3/8" - 1/2" x 48" iron rod set
- The landmarks may be replacing this rods with more substantial monuments in the near future.
- x steel rebar post set
- ⊙ stainless steel pipe set
- ⊙ These pipe are 3/4" or 1" inside diameter and 20" - 30" long. The have barbed points welded near bottom and are topped with a stainless steel plate ranging in size from about 2.5" square to about 6" square.
- △ nail set

Bearings are from RTK-GPS work and are Lincoln County Coordinate System grid bearings.

I, David E. Tusty, Registered Land Surveyor, do hereby certify that, by the direction of David Seidler, owner, I have made a survey of the North Half of the Southwest Quarter of Section 24, Township 34 North, Range 5 East, Lincoln County, Wisconsin, as shown hereon. I further certify that this map is a true and correct representation of said survey and that this survey is correct to the best of my knowledge and belief.

April 20, 2005
David E. Tusty
Wisconsin Registered Land Surveyor S-1390
Deerbrook, WI

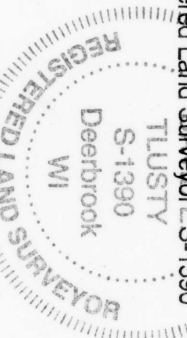

RECEIVED BY LINCOLN COUNTY
SURVEYOR THIS 27th DAY
OF April 20 05
County Surveyor

David E. Tusty, RLS Deerbrook, Wisconsin 54424			
Survey for David Seidler, owner The North Half of the Southwest Quarter of Section 24, T. 34 N., R. 5 E., Lincoln County, WI			
SCALE:	DATE:	DRAWN BY:	MAP #:
1" = 150'	April 2005		

L391A

As Surveyor RLS 4/20/05
D.E.T.