


PRELIMINARY
ASSESSOR'S PLAT

OF
 LOTS 8, 9, 10, 11 & 12
 OF THE UNRECORDED PLAT OF
 THIELER'S SQUAW LAKE SUBDIVISION
 BEING PART OF THE
 NE 1/4 OF THE SW 1/4
 SECTION 10, T35N, R8E,
 HARRISON TOWNSHIP
 LINCOLN COUNTY, WISCONSIN

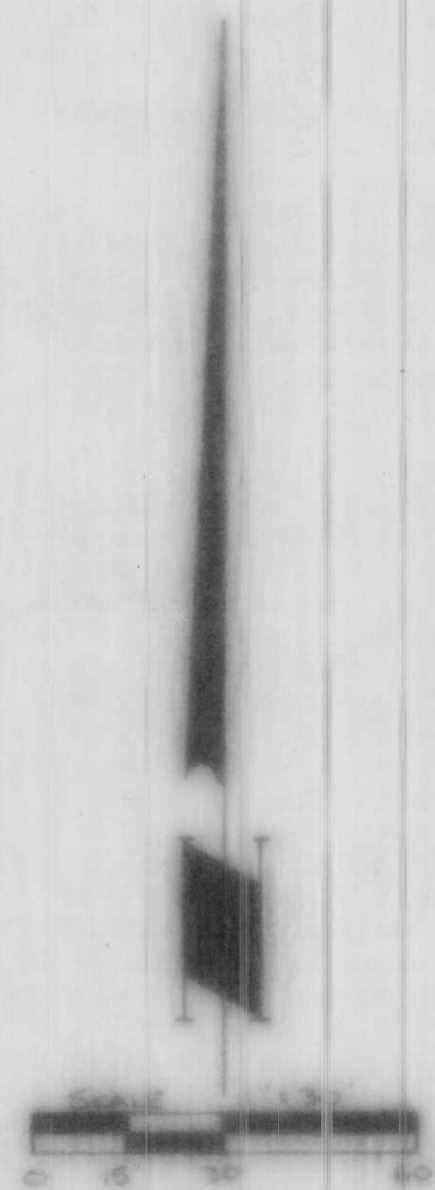


LEGEND

- 1 3/4" x 30" SPLIT ROUND SIGN SET, WEIGHING 1.55 LBS/LIN. FT.
- 1 1/2" x 30" SPLIT ROUND SIGN SET, WEIGHING 4.7 LBS/LIN. FT.
- 1 1/4" SIGN PIVOT ROUND IN PLACE

NOTE: THIS IS NOT A COMPLETED
 ASSESSOR'S PLAT. SEE THE ATTACHED
 REPORT OF SURVEY FOR DETAILS



Ajan Drum Associates, Inc.
 Wausau, Wisconsin

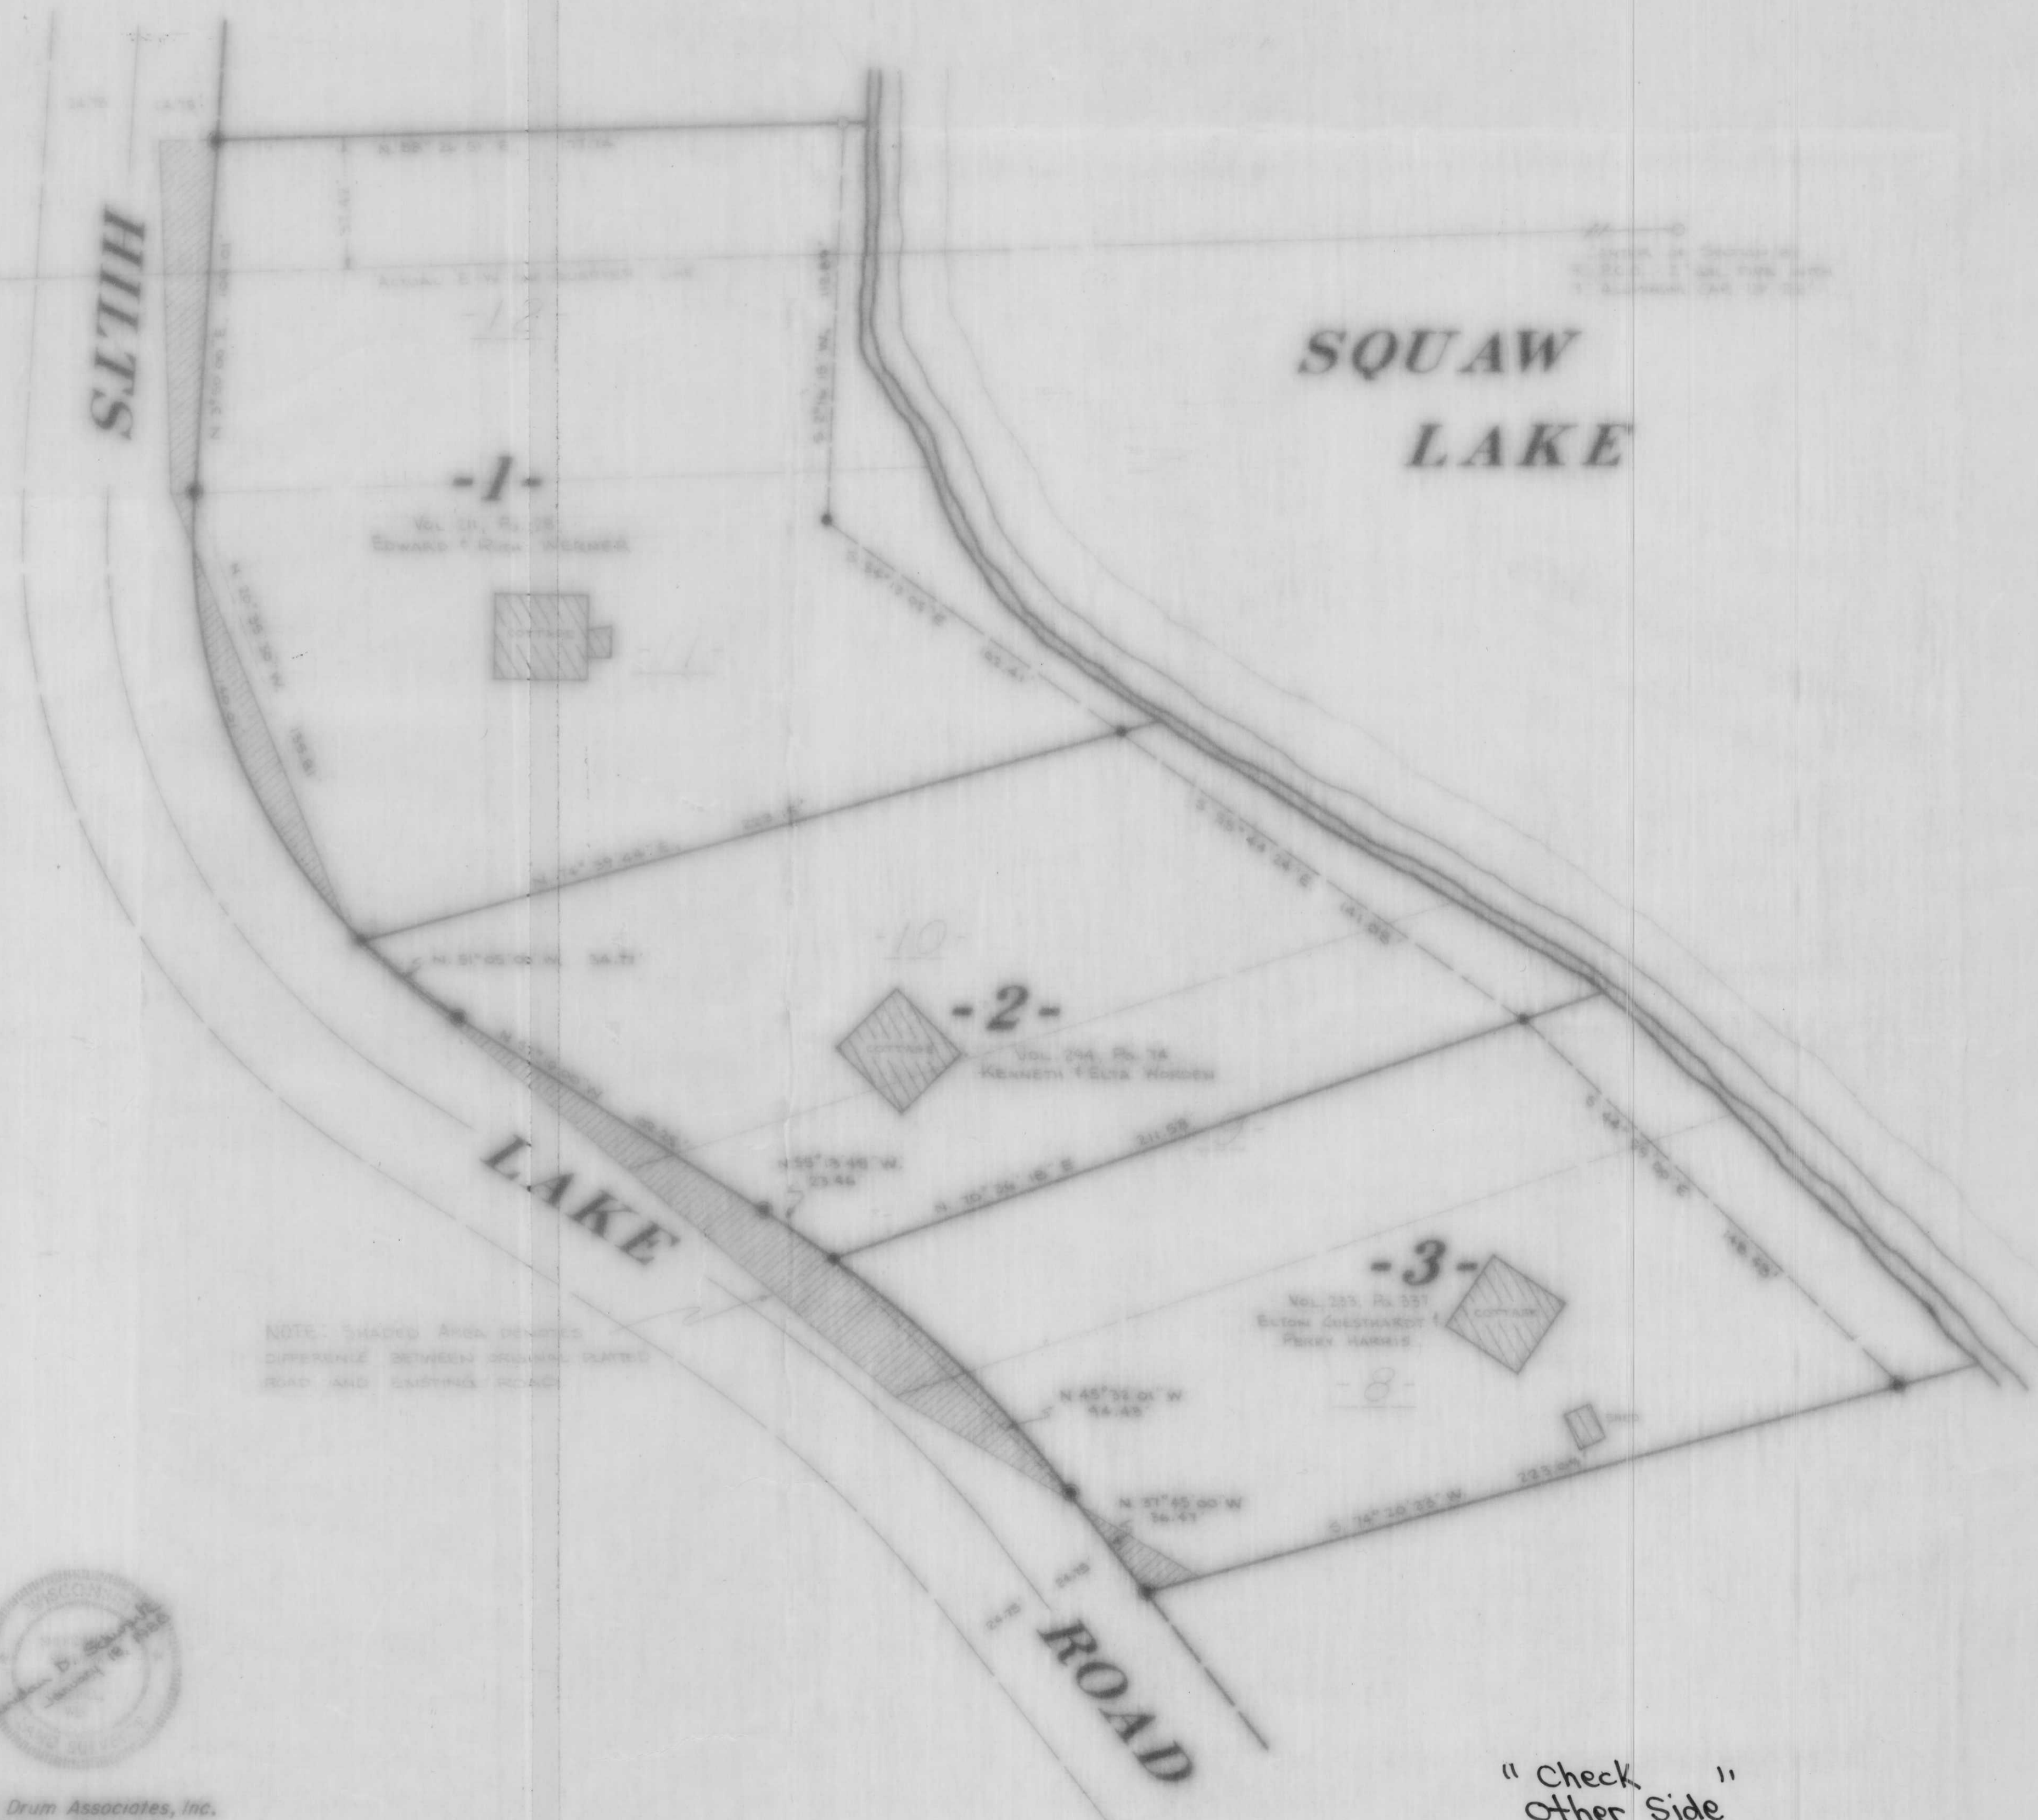


NOTE: SHADDED AREA DENOTES
 DIFFERENCE BETWEEN ORIGINAL SURVEY
 ROAD AND EXISTING ROAD

"Check
 other Side"

L29C

L29A

L59B

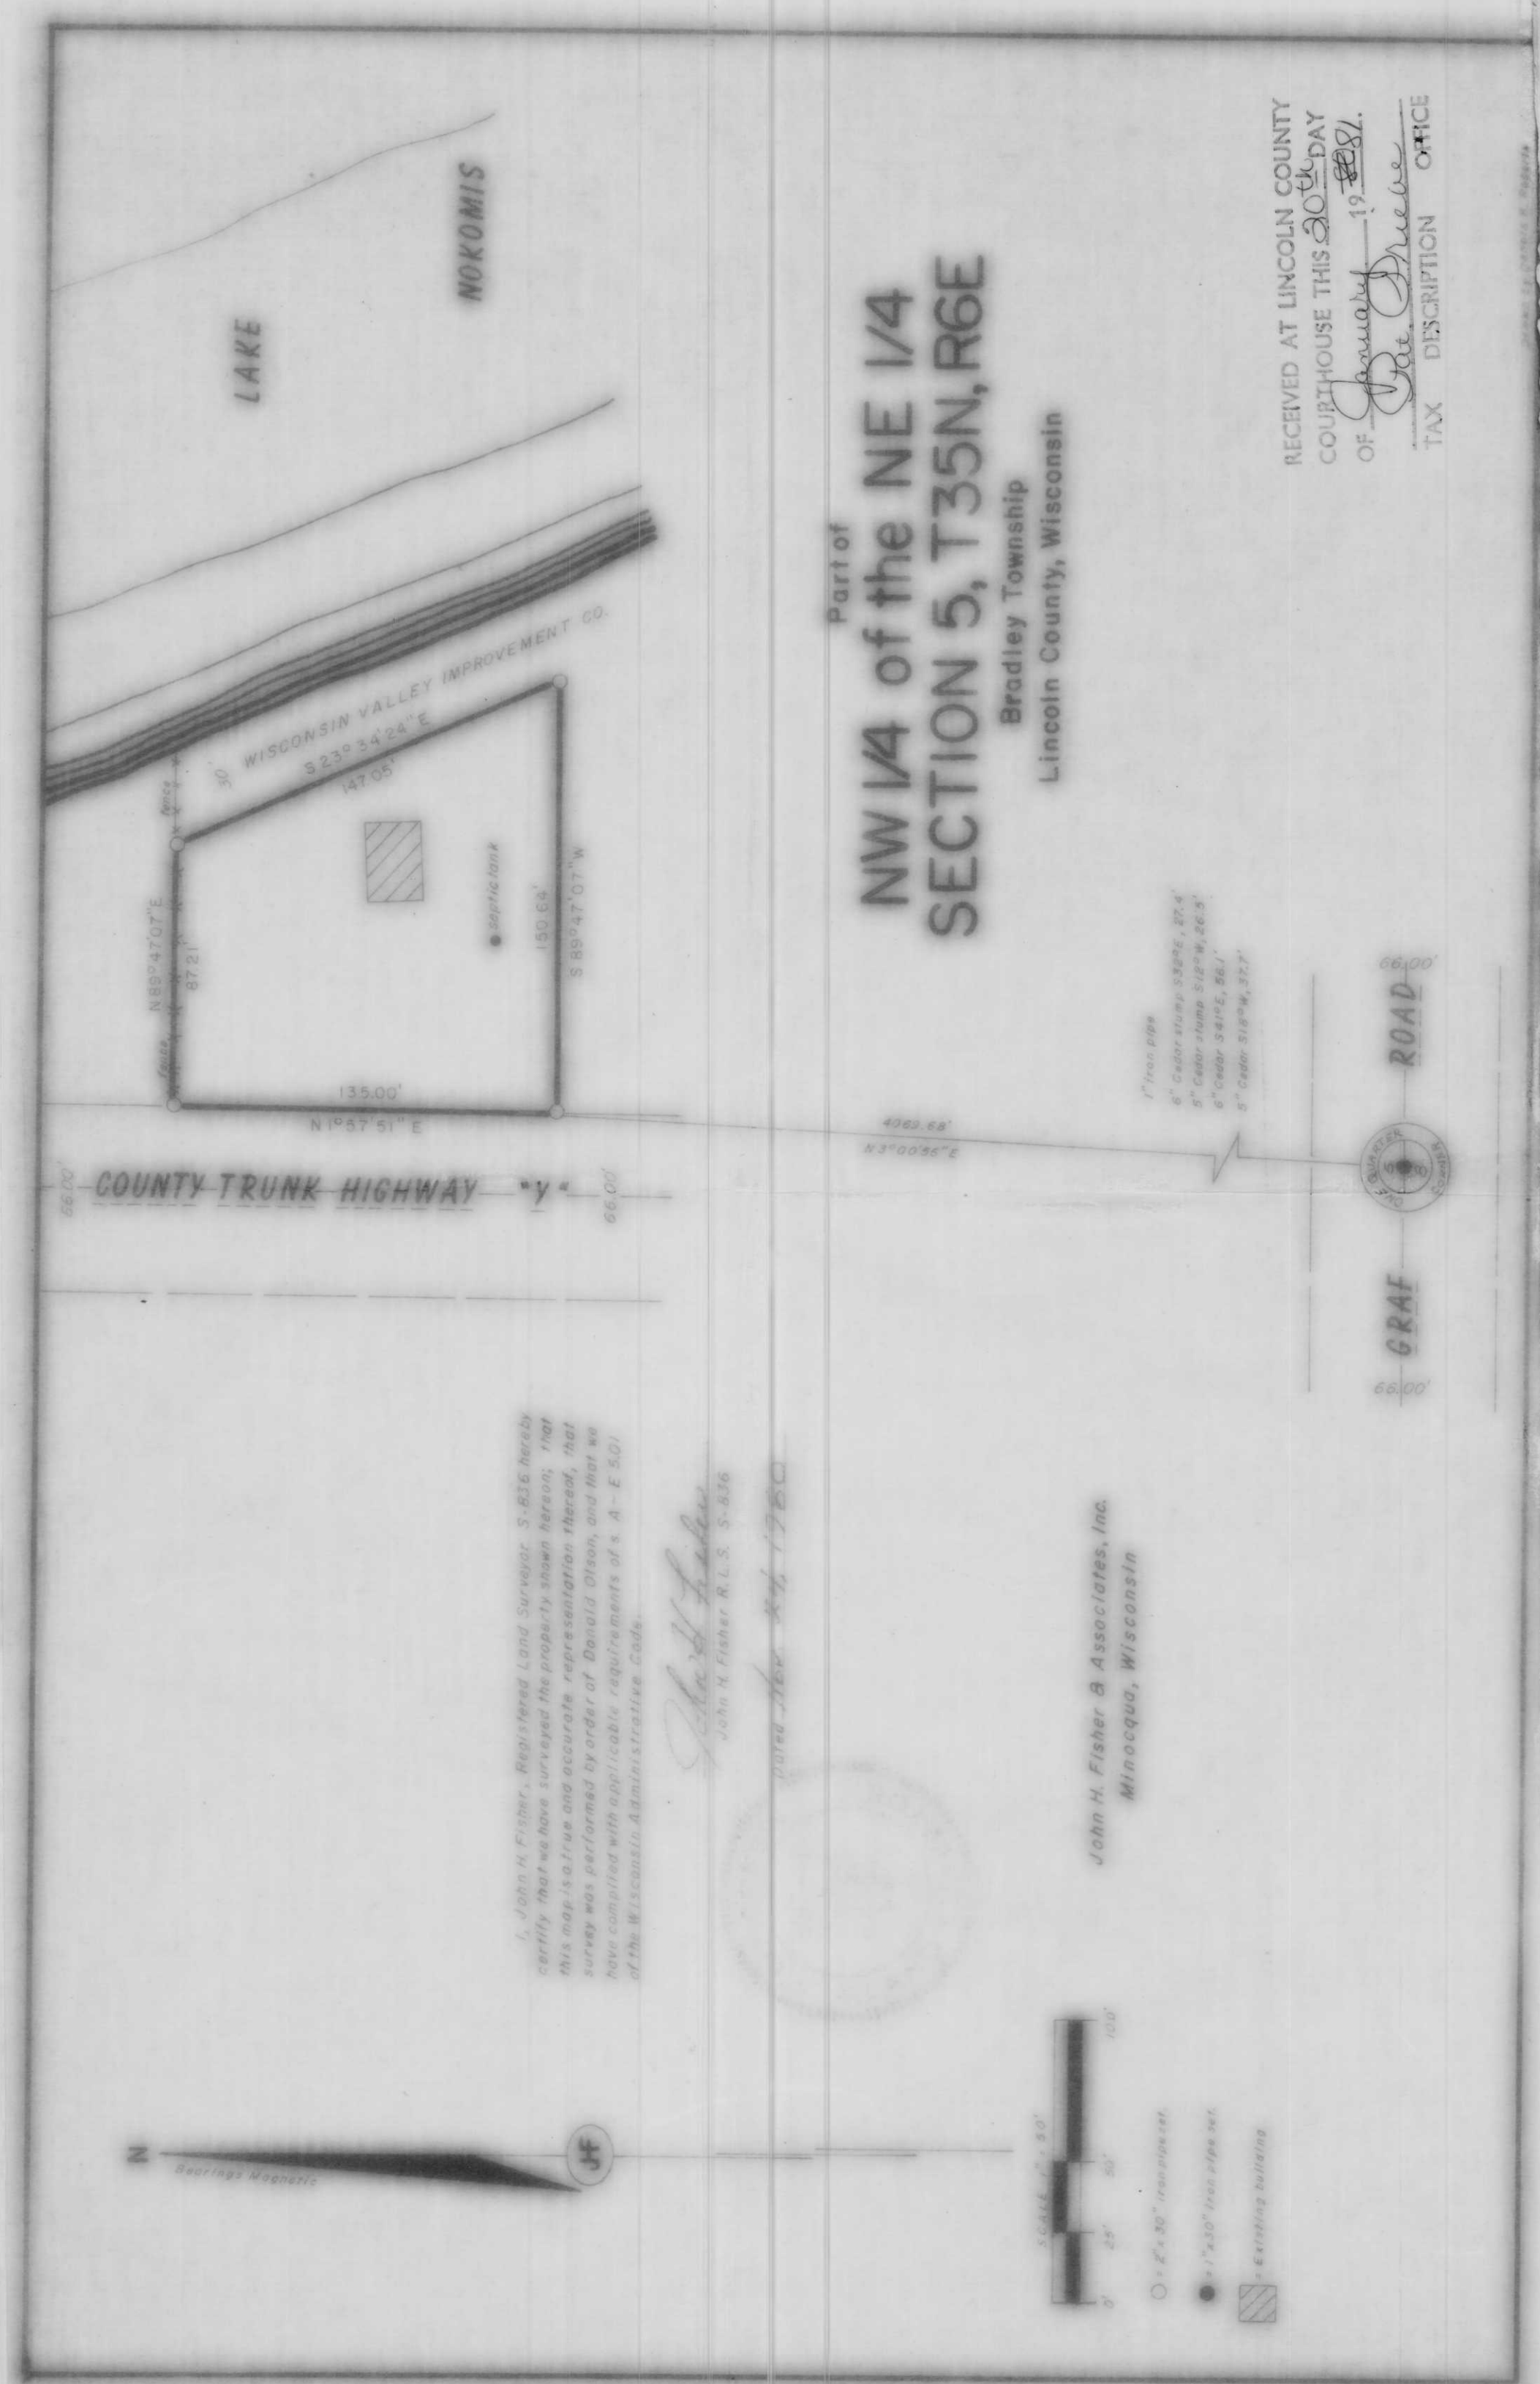


Part of
NW 1/4 of the NE 1/4
SECTION 5, T35N, R6E
 Bradley Township
 Lincoln County, Wisconsin

RECEIVED AT LINCOLN COUNTY
 COURTHOUSE THIS 20th DAY
 OF January 19 1980.
Pat Shee
 TAX DESCRIPTION OFFICE

I, John H. Fisher, Registered Land Surveyor, S-8316 hereby certify that we have surveyed the property shown herein, that this map is a true and accurate representation thereof, that survey was performed by order of Donald Olson, and that we have complied with applicable requirements of s. A - E 501, Stats. Wisconsin Administrative Code.

John H. Fisher
 John H. Fisher R.L.S. S-8316
 dated Nov 24 1980

John H. Fisher & Associates, Inc.
 Minocqua, Wisconsin

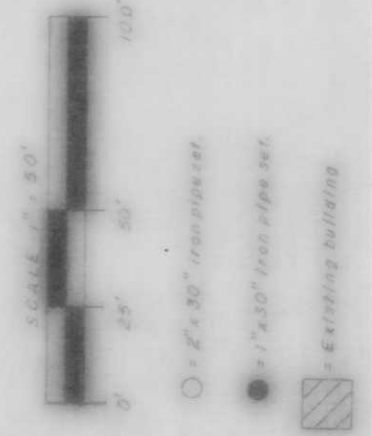

L59A ↑

Goes with
 A.P. Survey
 on Other Side

REPORT OF SURVEY
 11/25/80

On May 18, 1979 we gave Mr. Ken Worden an estimate to survey 3 lots on Squaw Lake (Lots 8,9,10,11 and 12 of Thielers Squaw Lake Subdivision being an unrecorded plat). We explained that we would base the survey on the East-West one-quarter line as established by Rhinelander Paper Company (R.I.P.C.O.), due to the fact that the north line of Lot 12 is shown on Thielers Subdivision as being the one-quarter line.

In early June, 1979 we did the field work to reestablish the East-West one-quarter line between R.I.P.C.O.'s Center of Section and the West one-quarter corner. We found that the actual one-quarter line fell 37.42 feet south of the line as marked by Sayers when he did the unrecorded plat, which alerted us to the fact that Sayers had established the East-West one-quarter line incorrectly. Since the Sayers plat is an unrecorded plat, the metes and bounds descriptions must be used in relocating the necessary corners. Therefore by using the true one-quarter line and the appropriate metes and bounds descriptions the lots would end up 37.42 feet south of the lines which all neighbors have been living to.

Realizing that this would create many problems in the neighborhood we approached Mr. Worden and suggested asking the Town of Harrison to order an Assessor's Plat of the subject lots pursuant to Chapter 70.27 of the State Statutes. Mr. Worden talked to the other people involved in this survey, who agreed and we then approached the Town with our request. On December 5, 1979 the Town of Harrison ordered an Assessor's Plat of Lots 8,9,10,11 and 12 of the unrecorded plat of Thielers Squaw Lake Subdivision.

We then proceeded by staking the lot corners using the original Sayers map and monuments pointed out by Mr. Worden. We used this information to try to set the lines at their original location as shown on the Thielers Subdivision map. One other discrepancy was found while staking the lots; the road was not built in the location as shown on the original map. Therefore we extended or shortened the lines to meet the existing road right-of-way as shown on the attached map. Next we sent a preliminary map and letter of explanation to all property owners and adjacent property owners explaining the Assessor's Plat procedure.

We received a call from the property owner north of the subject plat expressing concern about losing 37.42 feet from his lot if he agreed with this plat. We explained the situation and suggested contacting his northerly neighbor about a line by agreement or being included in this Assessor's Plat. His neighbor did not want to get involved, therefore he filed an objection to the Plat.

After many months of correspondence the people who approached us decided to forget the whole survey to avoid any conflicts with any neighbors. We then pulled the pipes that were shown on this map and are about to approach the Town asking them to cancel their order.

Alan Drum Associates, Inc.
Alan C. Drum
 Alan C. Drum,

Sheridan D. Schwark
 Sheridan D. Schwark,

L59C

L59A