

CERTIFIED LAND CORNER RESTORATION


Index No. C-1

State of Wisconsin }  
County of Lincoln } ss.

I Lester J. Schmit do hereby certify that on the 2nd day of May, 1975, I found evidence of the West 1/4 corner of Section 6 Township 32, North, Range 8 East, Fourth, Principal Meridian, as described hereon; and that from this evidence I established a new monument and accessories as described hereon to perpetuate the original location of this corner.

Resident witnesses:

Henry Gerbig

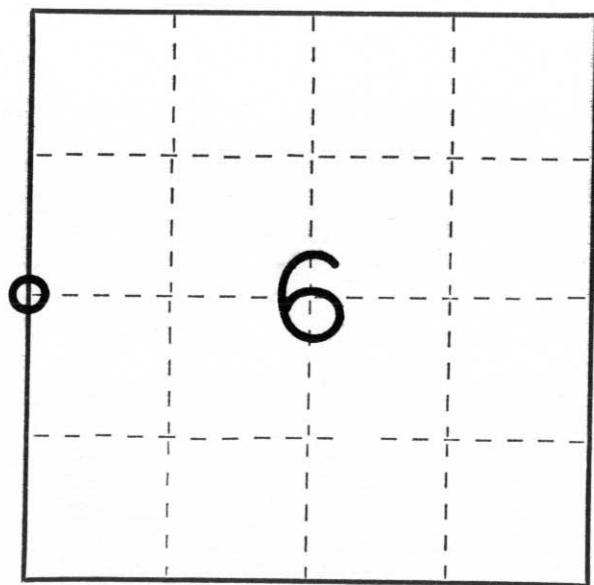

○ = Corner monument restored.

History of original corner establishment:

Surveyor: James Marsh

Date: 24 July 1851

Monumentation: Wood Post

Witnesses: 8" Hemlock S 58° E, 31 lks  
8" Hemlock S 40° W, 17 lks  
9" Hemlock N 25° W, 11 lks  
12" Hemlock N 60° E, 8 lks

Description of corner evidence found: A granite monument, 6" x 6" x 30", 10" below the surface of a Town Road, set about 1912 by the Government to replace original wood post. This granite monument is situated 3.4' west of the centreline of said Town Road.

Description of monument and accessories I established to perpetuate the original location of this corner.

Berntsen Monument - 30" (Set 24.80' west of granite monument which is W 1/4 cor., Sec. 6)

Berntsen Monument is to be Witness Corner to granite monument.

P.K. Nail in 11" White Pine S 24° E, 109.95'

P.K. Nail in 18" Sugar Maple S 32° W, 87.86'

P.K. Nail in 12" Elm N 55° W, 54.60'

Northwest corner of Barn foundation N 79° E, 102.39'

Iron Pipe next to granite monument is for location purposes only.

Dated at Rhineland, Wis., this 12th day of August, 1975

Signature Lester J. Schmit Title Land Surveyor Registration No. S-1192  
(County Surveyor, Registered Land Surveyor, or other duly authorized official)

Office of Register of Deeds, County of \_\_\_\_\_, I hereby certify that the within instrument was filed in this office for record on the \_\_\_\_\_ day of \_\_\_\_\_, 19\_\_\_\_ at \_\_\_\_\_ o'clock \_\_\_\_\_ M.

(Register of Deeds)

By \_\_\_\_\_ Deputy