

CERTIFIED LAND CORNER RESTORATION


Index No. I-17

State of Wisconsin }
County of Lincoln } ss.

I Sheridan D. Schwark, do hereby certify that on the 20th day of June, 19 78, I found evidence of the Northeast corner of Section 15 Township 33, North, Range 8 East, Fourth, Principal Meridian, as described hereon; and that from this evidence I established a new monument and accessories as described hereon to perpetuate the original location of this corner.

Resident witnesses:

.....
.....
.....

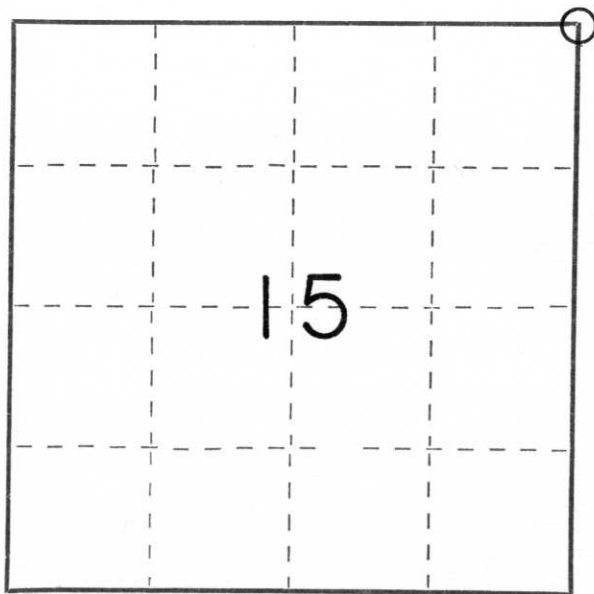

○ = Corner monument restored.

History of original corner establishment:

Date: October, 1854
Surveyor: Jackson Prentice
Monument: Wood Post
Witnesses: 16" Maple, S47°W, 26 links
12" Birch, N7°W, 15 links
20" Birch, N72°E, 60 links
11" Tamarack, S64°E, 62 links

Description of corner evidence found:

A 1 1/4" x 30" solid round iron rod was found in place. The rod was set at an earlier date to replace a broken off red granite monument.

Description of monument and accessories I established to perpetuate the original location of this corner.

We set a Lincoln County Berntsen monument with the following witness monuments:
1 1/4" x 30" solid round iron rod set 1' westerly of blazed 10" maple bearing N33°E, 86.57'
1 1/4" x 30" solid round iron rod set 1' westerly of blazed triple 11" basswoods bearing S85°E, 39.33'
1 1/4" x 30" solid round iron rod set 1' westerly of blazed double 10" basswoods bearing S46°E, 59.33'
1 1/4" x 30" solid round iron rod set 1' easterly of 2" white spruce bearing S14°W, 27.26'

Dated at Merrill, Wis., this 23rd day of June, 19 78.

Signature Sheridan D. Schwark Title Registered Land Surveyor Registration No. 1205
(County Surveyor, Registered Land Surveyor, or other duly authorized official)

Office of Register of Deeds, County of _____, I hereby certify that the within instrument was filed in this office for record on the _____ day of _____, 19 _____ at _____ o'clock _____ M.

.....
(Register of Deeds)

By _____ Deputy